


CB 4

Cable to Bus Bar
Horizontal cable tap
to horizontal bus



Tools Request :

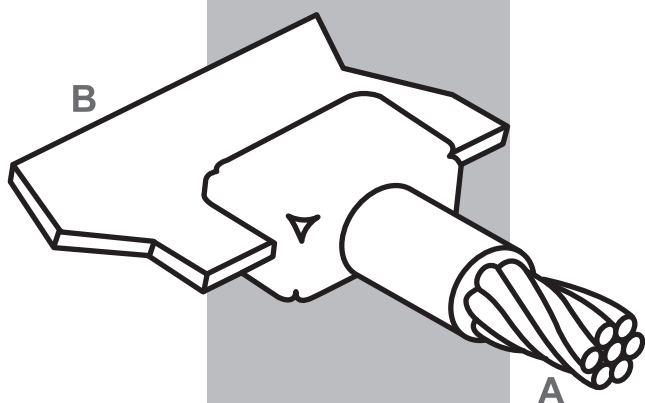

Tools Advice :

- Tool box
- Butane torch
- Butane gas
- Gloves

Note :

- SC means Solid Copper
- "2x150" means to use 2 tubes of 150 g - metal powder for one connection
- "2x200" means to use 2 tubes of 200 g - metal powder for one connection

Conductor Size		Metal Powder (g)	Graphite Mould Type	Handle Clamp Type
A mm ²	B mm.mm			
10	20 x 2	25	CB4-C-10202	HCC00
16	20 x 2	32	CB4-C-16202	HCC00
	20 x 3	32	CB4-C-16203	HCC00
	25 x 3	32	CB4-C-16253	HCC00
25	20 x 2	25	CB4-C-25202	HCC00
	20 x 3	32	CB4-C-25203	HCC00
	25 x 3	32	CB4-C-25253	HCC00
35	20 x 2	32	CB4-C-35202	HCC00
	20 x 3	45	CB4-C-35203	HCC00
	25 x 3	45	CB4-C-35253	HCC00
	25 x 6	65	CB4-C-35256	HCC00
2 x 35	25 x 6	115	CB4-C-3535256	HCC00
Ø 8 mm	25 x 2	45	CB4-C-8SC252	HCC00
	25 x 3	45	CB4-C-8SC253	HCC00
50	20 x 3	45	CB4-C-50203	HCC00
	25 x 2	45	CB4-C-50252	HCC00
	25 x 3	45	CB4-C-50253	HCC00
	25 x 4	65	CB4-C-50254	HCC00
	25 x 6	65	CB4-C-50256	HCC00
Ø 10 mm	25 x 3	65	CB4-C-10SC253	HCC00
	25 x 4	65	CB4-C-10SC254	HCC00
70	25 x 3	65	CB4-C-70253	HCC00
	25 x 4	65	CB4-C-70254	HCC00
	25 x 6	90	CB4-C-70256	HCC00
95	25 x 3	90	CB4-C-95253	HCC00
	25 x 4	90	CB4-C-95254	HCC00
	25 x 5	90	CB4-C-95255	HCC00
	25 x 6	115	CB4-C-95256	HCC00
120	25 x 3	90	CB4-C-120253	HCC00
	25 x 5	90	CB4-C-120255	HCC00
	25 x 6	115	CB4-C-120256	HCC00
	30 x 5	115	CB4-C-120305	HCC00
150	25 x 6	115	CB4-C-150256	HCC00
	30 x 5	115	CB4-C-150305	HCC00
	40 x 5	150	CB4-C-150405	HCC00
185	25 x 3	150	CB4-C-185253	HCC00
	30 x 5	150	CB4-C-185305	HCC00
	40 x 5	150	CB4-C-185405	HCC00
	50 x 5	150	CB4-C-185505	HCC00
240	50 x 6	150	CB4-C-185506	HCC00
	50 x 5	200	CB4-C-240505	HCC00
300	50 x 6	250	CB4-C-240506	HCC00
	50 x 8	2 x 150	CB4-D-300506	HCD00
		2 x 200	CB4-D-300508	HCD00

Special requirement can be requested